

DTC	P0133	Heated Oxygen Sensor Circuit Slow Response (Bank 1 Sensor 1)
------------	--------------	---

CIRCUIT DESCRIPTION

Refer to DTC P0125 (Insufficient Coolant Temp. for Closed Loop Fuel Control) on page [DI-40](#) .

DTC No.	DTC Detecting Condition	Trouble Area
P0133	Response time for the heated oxygen sensor's voltage output to change from rich to lean, or from lean to rich, is 1 sec. or more during idling after the engine is warmed up (2 trip detection logic)	Heated oxygen sensor (bank 1 sensor 1)

HINT:

Sensor 1 refers to the sensor closer to the engine body.

INSPECTION PROCEDURE

1	Are there any other codes (besides DTC P0133) being output?
----------	--

YES

Go to relevant DTC chart.

NO

**Replace heated oxygen sensor
(bank 1 sensor 1).**